

BA SeriesRupture Disk Burst Sensor

Over pressure indication for rupture disk or relief valve applications

When a pressure surge causes a relief valve to open, it also destroys the rupture disk under the valve. This leaves the valve vulnerable to chemical attack. The **BA Burst Sensor** reduces this threat by constantly monitoring the disk. When connected to an electrical alarm, the **BA Burst Sensor** alerts personnel to take immediate action to protect system components from further damage.

Operation

When a disk bursts, flow pulls one end of the **BA Burst Sensor's** conductor out of its retaining slot and opens the electrical circuit. The **BA Burst Sensor** can be reset by re-inserting the conductor into the retaining slot.

Features

- Re-useable
- Sizes 1" thru 24"
- Electrically conductive
- Installs on vent side of the disk holder or alone
- Requires minimal flange face-to-face clearance
- Adapts to virtually all makes/types of rupture disks, including Graphite types
- Fits easily into existing pipe systems
- Optional leak detection (BA-LD) for damaged rupture disks or fugitive emissions from relief valves or atmospheric designed systems
- BA-LD functions with or without a rupture disk



BA Operating Limits

Max. Temperature	700°F
Max. Continuous Temp	400°F
Max. Voltage	24 VDC
Max. Current	20 mA

Specifications

Disk Size	Minimum Burst Pressure* PSI @ 72°F (22°C)	Nominal Indicator Thickness	Thickness with Optional LD
1" - 2"	5	3/16″	1/4"
3″	3		
4"	2		
6" - 24"	1		

*Applies to both BA and BA-LD


Ordering Information

When ordering BA Series, specify: flange size, flange series, relieving pressure or pressure relief device, and coincident temperature



Note: BA and BA-LD is considered a simple device, therefore, approval is not required. Installation must be in accordance with ANSI/ISA RP12.6 and the NEC (ANSI/NFPA 70)

Bulletin no. 37002 Rev. 3 © 2002, 2003 ZOOK Enterprises, LLC, all rights reserved Printed in U.S.A. 6-06-2500-12M-CGG

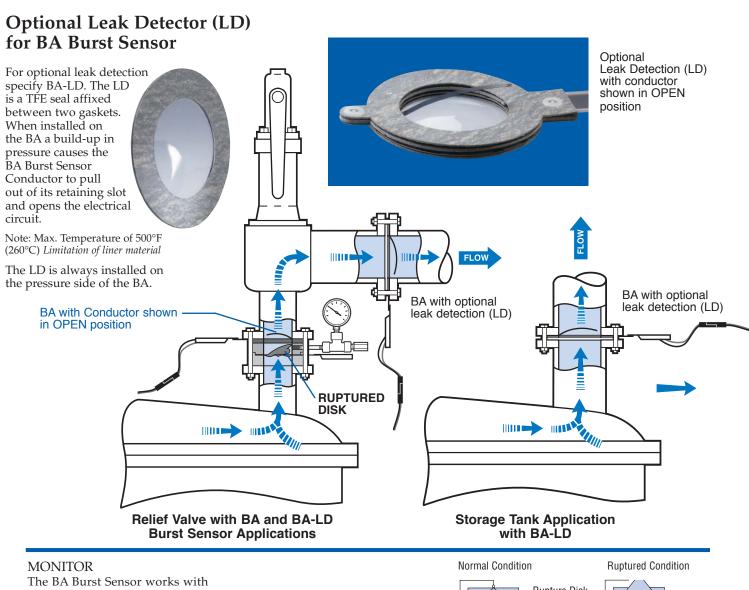

ZOOK ZM2 Alarm Monitor or any other monitoring system. Consult ZOOK for additional information.

The monitor wired to the BA Burst Sensor will be activated providing immediate local or remote warning of a ruptured disk. The ZM2 monitor allows output to control pumps, valves, and other equipment which may be activated to control or shutdown a process.

CAUTION

The BA Burst Sensor is an electrical device suitable for use in hazardous locations (Class I, II, and III, Division 1 and 2, Group A thru G) provided that it is used with an approved intrinsically safe electrical alarm monitor.

For services involving highly electrically conductive fluids, consult the ZOOK factory for this type of application.

Rupture Disk with BA CLASS I, II, III DIVISION 1 GROUPS A,B,C,D,E,F,G HAZARDOUS LOCATION NON-HAZARDOUS LOCATION Alarm Signals Audio & Visual ZOOK ZM2 Output Relay: Alarm Monitor Power Source: (2 Channels) Remote Alarm & 115/230 VAC @ 50/60 Hz; Activate other Devices 12 VDC

200K USA

16809 Park Circle Drive Chagrin Falls, OH 44022

Phone 440.543.1010 Toll Free 800.543.1043 440,543,4930 Fax E-Mail sales@zook.cc

PROCESS EQUIP., INC.

4400 South Service Road Burlington, ON Can. L7L 5R8

Phone 905,681,2885 800.370.6057 Toll Free Fax 905.681.8838

sales@proquipdisk.com

ZOOK EUROPE LTD

Unit 1.14, Great House Waterside Business Park Redwall Close, Rotherham Road Dinnington, Sheffield UK, S25 3QA

Phone 0044 (0) 1909 560999 Fax **0044 (0) 1909 560860** E-Mail zookeurope@zook.cc

Servicing Rupture Disk needs worldwide from manufacturing facilities located in 3 countries on 2 continents

24.7.365

visit us on the web at www.zook.cc